



**This kit services 103-3097 mule drive belt
used on Serial Numbers 370,000 through 398,999 Exmark Lazer only.**

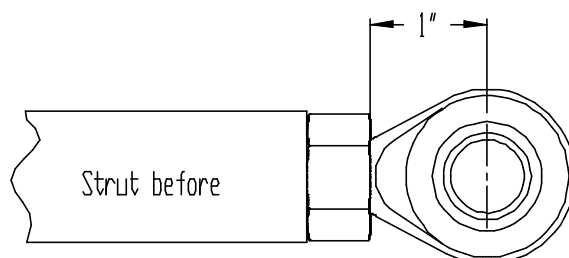

**Old Assembly # 103-1106 (52 & 60)
Old Assembly # 103-1082 (72)**

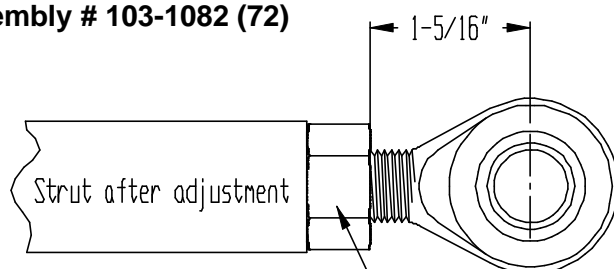

**New Assembly # 103-1081 (52 & 60)
New Assembly # 103-1083 (72)**

5/8 lock nut

Before installing new mule drive belt:

- 1) Measure between the 5/8 lock nut at the rear of the deck strut and the center of the rear strut bolt / ball joint. If this measures 1-5/16" as shown, skip to step 7.
- 2) Remove both 5/8 x 5 rear deck strut bolts.
- 3) Loosen 5/8 lock nuts on struts.
- 4) Adjust ball joints (lengthen strut) 5-1/2 to 6 turns to 1-5/16" as shown, from lock nut to center of ball joint.
- 5) Re-assemble ball joints to frame with rear strut bolts. Tighten bolts securely.
- 6) Tighten 5/8 lock nuts against struts. Torque nuts to 120-150 FT-LBS.
- 7) Install new 103-4014 belt included in kit. Refer to your Operators Manual for proper mule drive belt tension adjustment.
- 8) Replace your old Parts Manual with the manual (p/n 103-3059) included in Kit.